

A SEPARATE PLUG—IN HARNESS ADDITION IS SUPPLIED FOR HEADACHE RACK WIRING. IT PLUGS INTO THE MAIN BED HARNESS AT REAR END OF LEFT LONG SILL IF BED IS WIRED WITH HARNESS. IF BED IS WIRED WITH MULTIPLE WIRING CABLES, REMOVE CONNECTOR FROM HARNESS AND CONNECT INDIVIUAL WIRES TO THE PROPER BED WIRES. USING SCOTCHLOK CONNECTORS SUPPLIED.

REMOVE THE REFLECTIVE FILLERS FROM OVAL GROMMETS IN HEADACHE RACK.

ROUTE THE WIRING ALONG THE LEFT LONG SILL AND UP INTO BOTH VERTICAL TUBES. INSTALL GROMMETS INTO EACH OVAL HOLE. PULL THE 2-WIRE PLUG THROUGH THE LOWER OVAL HOLE AND PRESS INTO BACKUP LIGHT. INSERT THE LIGHT INTO THE GROMMET. PULL THE 3-WIRE PLUG THRU THE UPPER OVAL HOLE AND PRESS INTO THE TAIL LIGHT. REPEAT ON THE OTHER SIDE. SECURE WIRES WITH ADHESIVE BACKED WIRE CLIPS. CHECK FOR PROPER FUNCTION. PERFORM WIRING WITH TRUCK LIGHTS TURNED OFF.

NOTES A. BRING ALL WIRING THRU DRAIN HOLE IN PANEL.

REV A (1-02) REV B (5-02) REV C (10-06)

>	2	œ	1	6	
IVIO IIIT & COTO	BACKUP LIGHT OVAL	WIRE CLIP ADHESIVE BACKED	WIRING HARNESS	SCOTCH LOK	